

BLUE

Work Order ID 61038

August 4, 2010 1:38:10 PM



Item ID: D206-667-203BL

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft, Blue

Start Date: 8/04/10 Start Qty: 1.00



Cust Item ID:

Required Date: 8/16/10 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: ✓ Date: 10-8-04 Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Stop



QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
----------	--------------

D206-667-243	C
--------------	---

100

0.00



DOCUMENT CONTROL

DC

Memo

0.00

Document Control

Photocopy bluefile and create labels as per PPP D206-667-203 CHG003

8/10/09/08

for BG 10-9-02

110

0.00



BENDING MACHINE - CROSSTUBES

CNC Bend 2

Memo

0.00

CNC Alpha 160 Bender

Bend tube as per Dwg D206-667-243 using CNC bender program D206-667-203

IX MB 10-08-25

120

QC15- Crosstube Dimensional Check

0.00



QC

Memo

0.00

Quality Control

8/10/08/05

Q

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 61038**

August 4, 2010 1:38:10 PM

Page 2

Item ID: D206-667-203BL

Accept

Revision ID:

Item Name: Crosstube Aft, Blue

Start Date: 8/04/10 Start Qty: 1.00

Required Date: 8/16/10 Req'd Qty: 1.00

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_  
QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Run Start  
Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130



Crosstubes

Crosstubes

Crosstubes

**Memo**

0.00

1-Drill pilot holes in tube using drill Jig DT8583 & DT8584 and drill table DT8577 and tower holes #6 as per QSI0010 and as per Dwg D206-667-243. Drill all (3) top holes.

2-Drill and Ream all holes in tube to finish size using drill Jig DT8583 & DT8584 as per Dwg D206-667-243 Check dimensions between holes on all four sides.

3-Flip tube and switch drilling Jigs from right to left, left to right. Locate Jigs off existing holes using "T" pins.

4-Drill pilot holes using drill Jig DT8583 & DT8584 as per Dwg D206-667-243. Drill only the top (2) holes.

5-Drill & ream the top (2) holes to finish size using drill Jig DT8583 & DT8584 as per Dwg D206-667-243

6-Drill Fwd rivet holes using drill Jig DT8789FWD as per Dwg D206-667-143. Note: Fwd side has 3x top holes.

7-Drill Aft rivet holes using drill Jig DT8789 as per Dwg D206-667-243.

8-C'sink holes as per Dwg D206-667-243.

9 -Scribe part # and batch # using vibrating stylus as per Dwg D206-667-243 Inside of Cuff(Donot engrave on outside of tube)

10 -Deburr & Inspect for surface damage. Repair damage within limits as per

DP  
10-8-25

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



# Work Order ID 61038

August 4, 2010 1:38:10 PM



Page 5

Item ID: D206-667-203BL

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft, Blue

Start Date: 8/04/10 Start Qty: 1.00



Cust Item ID:

Required Date: 8/16/10 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Stop



QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

200

0.00



SprayPaint

SprayPaint

Spray Painting

Memo

0.00

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube

Spray paint Delfleet Blue

Delfleet Blue B 113171

Delfleet Clear B 113314

PRIME:

Start Time: 7:00

Finish Time: 8:00

PAINT:

Start Time: 11:00

Finish Time: 12:00

RT 10-06-30

210

QC14- Inspect Spray Paint

0.00



QC

Quality Control

Memo

0.00

Wrap in plastic bag to protect from scratches

MA 10 08 31 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 61038**

August 4, 2010 1:38:10 PM

Page 6

Item ID: D206-667-203BL

Accept

Setup Start

Revision ID:

Stop

Item Name: Crosstube Aft, Blue

Start Date: 8/04/10 Start Qty: 1.00

Cust Item ID:

Required Date: 8/16/10 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_  
QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Run Start

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

220

0.00



Crosstubes

Crosstubes

Memo

0.00

Crosstubes

1-Install nut plates as per Dwg D206-667-243.

RT 10-08-50

230

0.00



Skidtubes

Crosstubes

Memo

0.00

Crosstubes

1-Install support using 0.03" to 0.06" thick layer of magnobond 6398 per QSI 015. Let cure for 12h after installation and prior to packaging. Note: (3) top holes should be facing up.

A/R Magnobond 6398 : 114158

2-Install supports and clamps as per Dwg D206-667-243. Torque clamps to 80-100 in lb

ml 10.09.02 ①

RT 10-08-01

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 61038**

August 4, 2010 1:38:10 PM



Page 7

Item ID: D206-667-203BL

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Aft, Blue

Start Date: 8/04/10 Start Qty: 1.00



Cust Item ID:

Required Date: 8/16/10 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start



QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
240  QC Quality Control	QC5- Inspect part completeness to step on W/O  Memo	0.00  0.00				1			100%ve
250  Packaging Packaging	Pick Kit  Memo	0.00  0.00							10/9/2 sl
260  QC Quality Control	QC4- 100% Inspect kits for completeness  Memo	0.00  0.00							@

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 61038**

August 4, 2010 1:38:10 PM

Page 8

Item ID: D206-667-203BL

Accept

Setup Start

Revision ID:

Stop

Item Name: Crosstube Aft, Blue

Start Date: 8/04/10 Start Qty: 1.00

Cust Item ID:

Required Date: 8/16/10 Req'd Qty: 1.00

Customer:



Reference:


Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
270		0.00							
	Packaging								
Packaging	Memo	0.00							
Packaging	Identify and pack for shipping as per PPP D206-667-203								
	Location: _____								
	PPP Rev: <u>D</u>								
280		0.00							
	QC21- Final Inspection - Work Order Release								
QC	Memo	0.00							
Quality Control									

10/09/08 MF  
10-9-8

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



# Picklist Print

August 4, 2010 1:38:14 PM

Page 1

Work Order ID: 61038

Parent Item: D206-667-203BL

Parent Item Name: Crosstube Aft, Blue



Start Date: 8/04/10

Required Date: 8/16/10

Start Qty: 1.00

Required Qty: 1.00

## Comments:

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

AN5-10A 		Purchased	No				Each	159.0000	10	10			
Bolt													

Location	Loc Qty	Loc Code
ST337	159	
114752	59	
115108	100	

AN5-32A 		Purchased	No				Each	232.0000	4	4			
Bolt													

Location	Loc Qty	Loc Code
ST340	232	
113121	4	
114056	74	
114405	50	
115016	50	
115108	50	
15072	4	

AN5-34A 		Purchased	No				Each	88.0000	4	4			
Bolt													

Location	Loc Qty	Loc Code
ST340	88	
113149	38	
113226	50	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Picklist Print

August 4, 2010 1:38:14 PM

Work Order ID: 61038

Parent Item: D206-667-203BL

Parent Item Name: Crosstube Aft, Blue

Start Date: 8/04/10

Required Date: 8/16/10

Start Qty: 1.00

Required Qty: 1.00

AN960JD516

NAS1149D0563J

Purchased

No

Each

34.0000

18 18



Washer



MB 10/9/25

Location

Loc Qty

Loc Code

ST

34

103694

18

107534

12

109287

4

D206-667-203TRN

Manufactured

No

Each

2.0000

1

1



Crosstube Turning Detail



MB 10-08-25

Location

Loc Qty

Loc Code

LG

2

60377

1

60378

1

D2873-043

Manufactured

No

Each

32.0000

2

2



Nut Plate Assembly



ET 10-08-30

Location

Loc Qty

Loc Code

LG

32

53966

10

56466

2

57337

20

D2873-045

Manufactured

No

Each

28.0000

2

2



Nut Plate Assembly



ET 10-08-30

Location

Loc Qty

Loc Code

LG

28

53968

9

57336

19

X2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Picklist Print

August 4, 2010 1:38:14 PM

Work Order ID: 61038



Parent Item: D206-667-203BL



Parent Item Name: Crosstube Aft, Blue

Start Date: 8/04/10

Required Date: 8/16/10

Start Qty: 1.00

Required Qty: 1.00

D2892-1 Manufactured No

Each 48.0000 2 2



ET 10-09-01

Support

Location	Loc Qty	Loc Code
LG	48	
41986	12	
42785	20	
53124	11	
55787	5	

x2

ATTN: BLUE

D3595-063-450 Manufactured No

Each 38.5390 4 4



ET 10-09-01

RUBBER CUSHION

B60983 x4

Location	Loc Qty	Loc Code
LG	38.53897368	
53775	5.97897368	
58161	3.56	
59580	29	

MS20601-AD4W10 Purchased No

Each 72.0000 14 14



ET 10-08-30

RIVET

Location	Loc Qty	Loc Code
LG051	58	
114245	58	
ST322	14	
113220	14	

x14

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Picklist Print

August 4, 2010 1:38:14 PM

Work Order ID: 61038

Parent Item: D206-667-203BL

Parent Item Name: Crosstube Aft, Blue

Start Date: 8/04/10

Required Date: 8/16/10

Start Qty: 1.00

Required Qty: 1.00

MS21042L5

Purchased

No

Each

764.0000

4

4



10/9/28/

Nut

Location

Loc Qty

Loc Code

ST139

264

114813

264

4

ST300

500

115156

500

MS21920-22

Purchased

No

Each

102.0000

4

4



85 10-09-01

Clamp(per MIL-DTL-8783C)

Location

Loc Qty

Loc Code

LG

102

111210

3

114077

99

xy

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



<b>DART AEROSPACE LTD</b>		<b>Work Order:</b>	61038
<b>Description:</b> Crosstube High Aft (206L)		<b>Part Number:</b>	D206-667-203
<b>Inspection Dwg:</b> D206-667-243 <b>Rev:</b> C		<b>Page 1 of 1</b>	

Required Dimension	Min	Max
Height	23.39	23.65
1/2 Span	41.79	42.05
Angle	54	56
Total Span	83.58	84.1

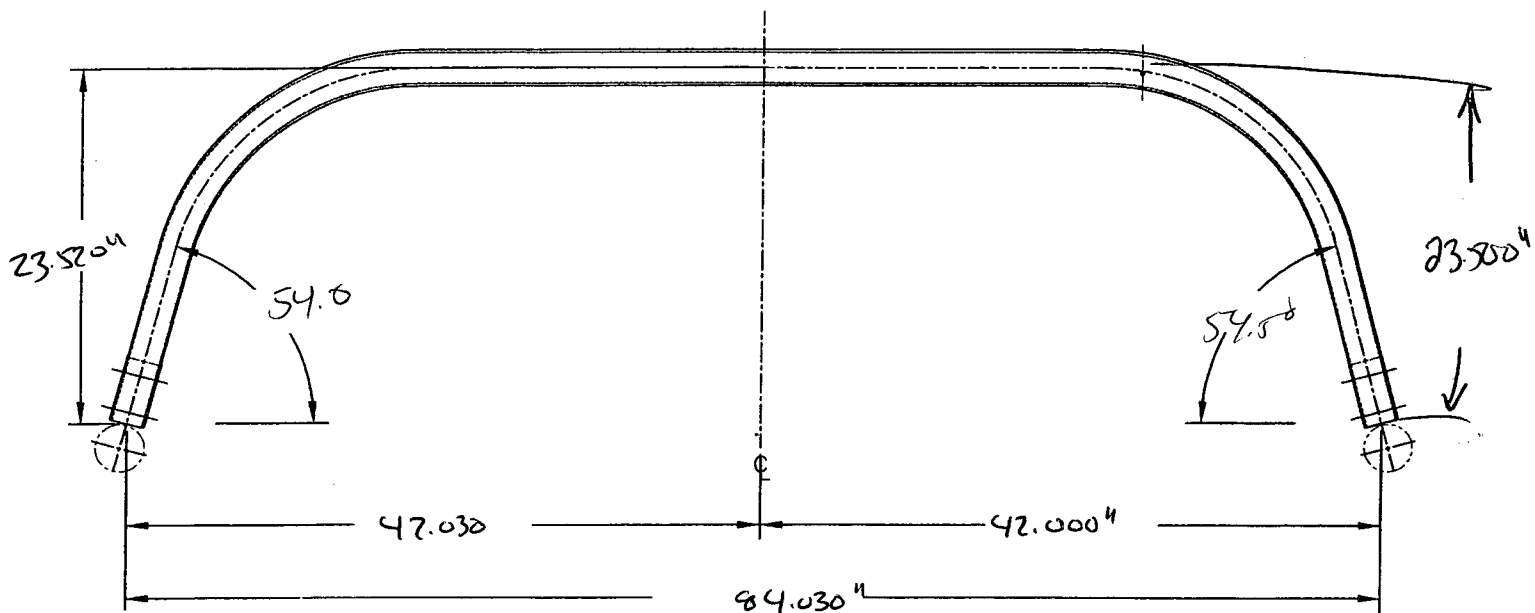

Comments

QC15 Inspection	8
Date	10/06/25

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	09.11.17	Dwg Rev updated	KJ	
C	09.12.14	Dimensions update per Dwg Rev C	KJ	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Item	Qty	Part Number	Description
	-243		
1	X	D206-667-243	CROSSTUBE ASSEMBLY (206L HIGH AFT)
2	1	D6004-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2892-1	SUPPORT
6	4	D3595-063-450	RUBBER CUSHION
7	4	MS21920-22	CLAMP
8	14	MS20601AD4W10	RIVET (OR NAS9302B-4-10)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299- 947-100, TYPE II, CLASS 2 ADHESIVE)

# **GENERAL NOTES:**

- 1) MATERIAL: MANUFACTURED FROM D6004-115  
FINISHED LENGTH = 104.91±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D206-667-243" AND BATCH NUMBER ON  
INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 21.9 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY,  
TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE  
TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2892-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER  
QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-22 CLAMPS WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE  
D2892-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS ARE  
LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE  
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS  
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT  
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN  
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. *61038*  
*BS 10-8-09*

**RELEASED**  
*8/11/12*

C	REVISE GENERAL NOTES/PART LIST (ZN D7-1); REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS. D3595-063-450 WAS D2856-400-773 (ZN D6-2 & A5-2); REMOVED REF. & ADD TOLERANCES (ZN 4-3, C5-3, D3-3); RELOCATED FLAG #6 (ZN A8-3) PER NCR 210; MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	08.11.06
B	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKUDTUBES	PH	05.07.26
A	NEW ISSUE	CP	00.11.17
REV.	DESCRIPTION	BY	DATE
DESIGN	<i>RF</i>	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
DRAWN	<i>RF</i>	DRAWING NO.	REV. C
CHECKED	<i>RF</i>	D206-667-243	SHEET 1 OF 4
MFG. APPR.	<i>RF</i>	TITLE	SCALE
APPROVED	<i>RF</i>	CROSSTUBE ASSY (206L HIGH AFT)	NTS
DE APPR.	<i>RF</i>	DATE 08.11.06	
<small>COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>			


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

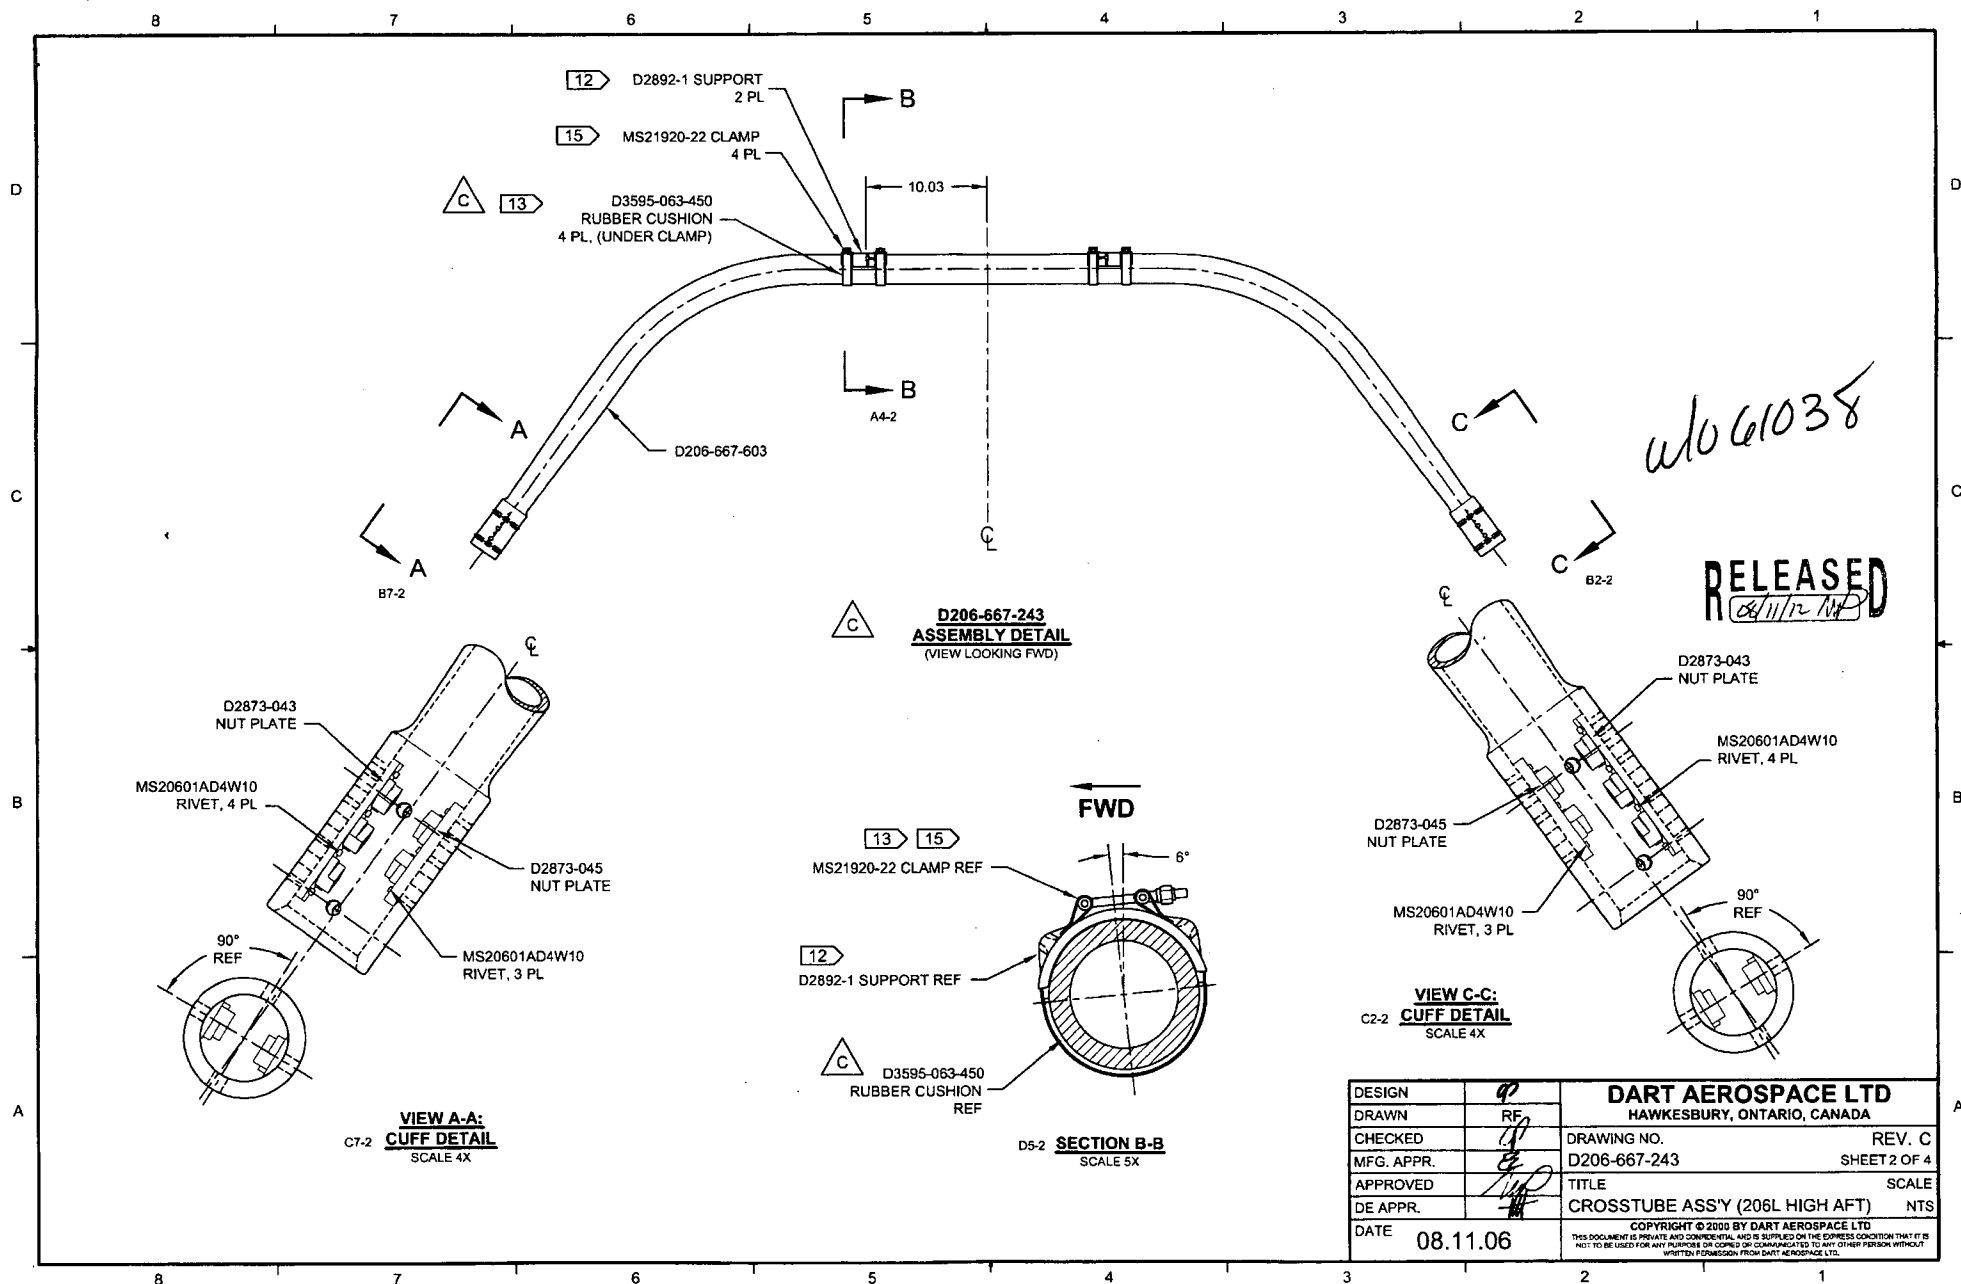

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_


Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


**NOTE:** Date & initial all entries




SEE DETAIL L  
B7-4

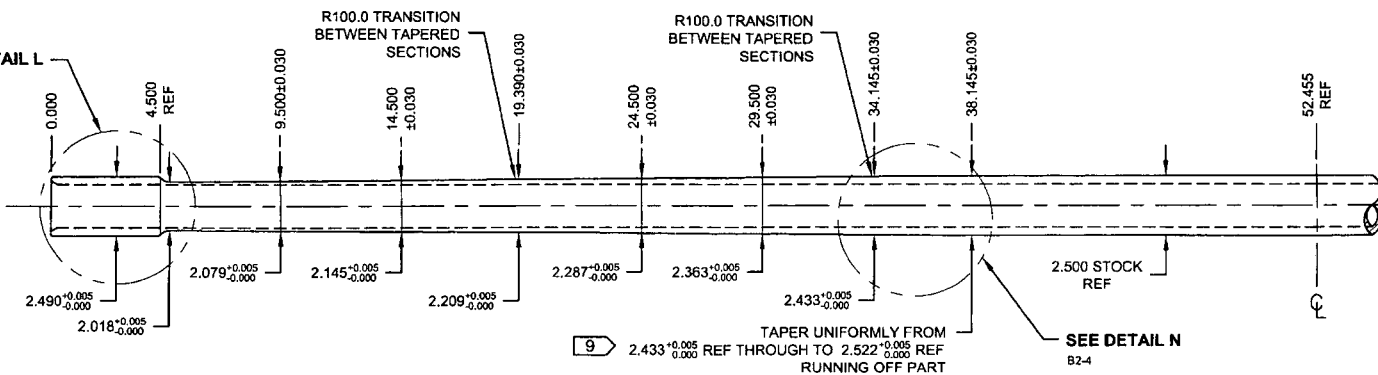


**C TURNING DETAIL**

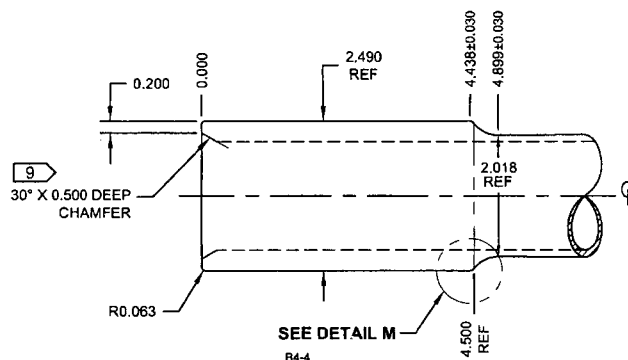

**C7-4 DETAIL L: CROSSTUBE CUFF**  
NOT TO SCALE

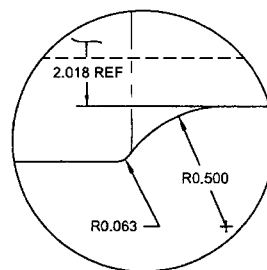

**B6-4 DETAIL M: CUFF TRANSITION**  
NOT TO SCALE

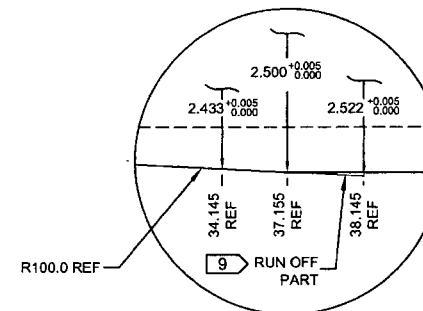

**DETAIL N: TAPER RUN-OFF**  
C4-4 NOT TO SCALE

**RELEASED**  
08/11/12

DESIGN	9	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO. D206-667-243	REV. C
MFG. APPR.			SHEET 4 OF 4
APPROVED		TITLE CROSSTUBE ASSY (206L HIGH AFT)	SCALE
DE APPR.			NTS
DATE	08.11.06	COPYRIGHT © 2006 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

## 5.0 PARTS LIST

Item	Qty -011	Qty -013	Qty -015	Qty -101	Qty -201	Qty -103	Qty -203	Qty -105	Qty -205	Part Number	Description
	X									D206-667-011	SPACER BLOCK KIT
		X								D206-667-013	NUT PLATE KIT (-101/-103/-105/-203/-205)
			X							D206-667-015	NUT PLATE KIT (-201)
				X						D206-667-101	CROSSTUBE INSTALLATION, 206A/B HIGH FWD
					X					D206-667-201	CROSSTUBE INSTALLATION, 206A/B HIGH AFT
						X				D206-667-103	CROSSTUBE INSTALLATION, 206L/L-1/L-3/L-4 HIGH FWD
							X			D206-667-203	CROSSTUBE INSTALLATION, 206L/L-1/L-3/L-4 HIGH AFT
								X		D407-667-105	CROSSTUBE INSTALLATION, 407 HIGH FWD
									X	D407-667-205	CROSSTUBE INSTALLATION, 407 HIGH AFT
1				1						D206-667-141	CROSSTUBE ASSEMBLY, 206A/B HIGH FWD
2					1					D206-667-241	CROSSTUBE ASSEMBLY, 206A/B HIGH AFT
3						1				D206-667-143	CROSSTUBE ASSEMBLY, 206L/L-1/L-3/L-4 HIGH FWD
4							1			D206-667-243	CROSSTUBE ASSEMBLY, 206L/L-1/L-3/L-4 HIGH AFT
5								1		D407-667-145	CROSSTUBE ASSEMBLY, 407 HIGH FWD
6									1	D407-667-245	CROSSTUBE ASSEMBLY, 407 HIGH AFT
10				*2	*2	*2		*2		D2891-1	SUPPORT
11							*2			D2892-1	SUPPORT
12									*1	D2894-1	SUPPORT
13				*2	*2	*2		*2		D2856-400-694	ABRASION STRIP
14							*2		*2	D2856-400-773	ABRASION STRIP
15									*1	D2856-600-851	ABRASION STRIP
16				*4	*4	*4		*4		MS21920-20	CLAMP
17							*4		*4	MS21920-22	CLAMP
18									*2	MS21920-24	CLAMP
19				4	4	4		4		AN5-32A	BOLT
20							4		4	AN5-34A	BOLT
21				4	4	4	4	4	4	MS21042L5	NUT (OR MS21042-5)
22				8	8	8	8	8	8	AN960JD516	WASHER
23									*2	D3190-1	CHAFING SHIELD
30	8									AN4-6A	BOLT
31	8									AN4-7A	BOLT
32	16									AN960JD416	WASHER
33	2									D3193-041	SPACER BLOCK ASSEMBLY
40		2		*2		*2	*2	*2	*2	D2873-043	NUT PLATE
41		2		*2		*2	*2	*2	*2	D2873-045	NUT PLATE
42			2		2					D2872-043	NUT PLATE
43			2		2					D2872-045	NUT PLATE
44		10		10		10				AN5-7A	BOLT
45		10	10		10		10	10	10	AN5-10A	BOLT
46		4	4	4	10	4		4		AN5-30A	BOLT
47		4					4		4	AN5-32A	BOLT
48		18	18	10	12	10	10	10	10	AN960JD516	WASHER
49		4	4		6					MS21042L5	NUT (OR MS21042-5)

\*REFERENCE ONLY. PARTS ARE INCLUDED IN D206-667-141/241/143/243, &amp; D407-667-145/245 ASSEMBLIES ABOVE

• COPYRIGHT © 2001 BY DART AEROSPACE LTD. •

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

Revision: C  
Date: 05.07.26



## LIQUID PENETRANT TEST REPORT

P- 15187

CLIENT	DART Aerospace	DATE	Aug 27-2010	PAGE	1	OF	1	
ATTENTION	LINDA/CHANTEL	ACUREN JOB NO.	188-10-0829	TIME	AM	<input checked="" type="checkbox"/>	PM	<input type="checkbox"/>
ADDRESS	1270 ABELDEEN STREET HAWKESBURY ON. K6A 1K7	PO/VO NO.		WORK LOCATION	HAWKESBURY PLANT			
PROJECT	F.P.I.	ACCEPTANCE STD.	ASTM 1417	REV./DATE	2007			
ITEM(S) EXAMINED	9 PCS							

JOB DESCRIPTION	PROCEDURE NO. LT-002 REV./DATE -	TECHNIQUE NO. LT-TECH2 REV./DATE -
PART NO.	MATERIAL ALUMINUM THICKNESS VARIOUS	
SCOPE	WET FLUORESCENT LIQUID PENETRANT INSPECTION CARRIED OUT 100% EXTERNAL.	

TEST DETAILS	
METHOD <input checked="" type="checkbox"/> FLUORESCENT <input type="checkbox"/> VISIBLE	<input checked="" type="checkbox"/> WATER WASH <input type="checkbox"/> SOLVENT REMOVABLE <input type="checkbox"/> POST EMULSIFIED
FAMILY BRAND MAGNA FLUX	BLACK LIGHT S/N 16459 <input type="checkbox"/> OUTPUT > 1000 $\mu$ W/cm <sup>2</sup> <input type="checkbox"/> AMBIENT < 2 fc
PENETRANT ZL 67 MINIMUM DWELL TIME 45 MIN.	LIGHTING EQUIP. <input type="checkbox"/> FLASHLIGHT <input type="checkbox"/> TROUBLELIGHT <input type="checkbox"/> OUTPUT > 100 fc @ SURFACE
PENETRANT REMOVER H2O MINIMUM DRY TIME > 10 MIN.	OTHER LABINO
DEVELOPER SKD 52 MINIMUM DWELL TIME 10 MIN.	LIGHT METER S/N 1098866 CAL DUE DATE OCT 19 2010
DEVELOPER TYPE <input checked="" type="checkbox"/> NON AQUEOUS <input type="checkbox"/> AQUEOUS <input type="checkbox"/> DRY	

TEST SURFACE	
SURFACE CONDITION <input type="checkbox"/> AS GROUND <input type="checkbox"/> AS WELDED <input type="checkbox"/> MACHINED <input type="checkbox"/> SHOT BLASTED <input checked="" type="checkbox"/> CLEAN BARE METAL	
SURFACE TEMPERATURE <input type="checkbox"/> < -4°C/ 20°F <input type="checkbox"/> -4°C/ 20°F TO 10°C/50°F <input checked="" type="checkbox"/> 10°C/50°F TO 52°C/125°F <input type="checkbox"/> > 52°C/125°F	

RESULTS- <input type="checkbox"/> METRIC <input type="checkbox"/> IMPERIAL	
1 - CROSS TUBE W.O. 61038 ✓	
1 - CROSS TUBE W.O. 61037 ✓	
1 - CROSS TUBE W.O. 61387 ✓	
1 - CROSS TUBE W.O. 61388 ✓	PT 1008-30
1 - CROSS TUBE W.O. 60523 ✓	
1 - CROSS TUBE W.O. 60524 ✓	
1 - CROSS TUBE W.O. 61036 ✓	
1 - CROSS TUBE W.O. 61035 ✓	
1 - CROSS TUBE W.O. 60573 ✓	

**Scope of Services**  
The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

**Standard of Care**  
In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES	
CLIENT REPRESENTATIVE	DTR # E27424
TECHNICIAN (SIGNATURE):	REPORT REVIEWED BY:
NAME (PRINT): Mike Johnston	NAME INITIALS
1 <sup>st</sup> TECHNICIAN	2 <sup>nd</sup> TECHNICIAN
CGSB LEVEL 1 SNT LEVEL	CGSB LEVEL SNT LEVEL
CGSB REG. No 6606	CGSB REG. No